

Subminiature Load Cell

MODEL 8413, MODEL 8414 with overload protection







Model 8414 with overload protection

Highlights

- Measuring ranges from 0 ... 5 N up to 0 ... 5 kN
 0 ... 1.1 lbs up to 0 ... 1124.0 lbs
- Especially flat design from 3.3 mm
- Non-linearity 0.25 % F.S.
- Made of high quality stainless steel

Options

- Extended temperature compensated range -55 °C ... +120 °C
- burster TEDS
- Various cable lengths available
- Standardized output signal 1.0 mV/V

Applications

- Adjustment of gauges
- Force measurements on the inside of precision tools
- Monitoring of control elements
- Regulation of forces in medical technology
- Control instruments in precision machinery
- Adjustment and pre-load of devices

Product description

This miniature force sensor was optimised with respect to its height and is, at only 3.4 mm, the lowest known sensor with strain gage technology. Hardly higher than the diameter of its connection cable, it can also be housed in conditions where space is limited. Along with its minimal geometry, the force sensor is also particularly light. It has a high resonance frequency to follow quickly changing load alternations. Despite its extreme miniaturisation, in its application it remains completely robust and suitable for industry, not only with regard to the highly flexible cable connections or the full welding of sensors for the measurement ranges $\geq 0 \dots 10 \ N.$


The miniature compression force sensors are flat, cylindrical discs with covered bottoms. The central load application button for taking on compression forces is an integrated part of the top, which is the sensor's membrane. On its bottom, the strain gages are fixed on the inside of the housing and interconnected with a full Wheatstone bridge. This passes on, for force applications, an output voltage which is directly proportional to the size of the measurement.

The connection cable exits radially from the sensor housing and is additionally stabilised by a case for measurement ranges $\geq 0 \dots 10 \ N.$ The support area of the bottom of the sensor is annular, however arranged as a circular area for measurement range $0 \dots 5 \ N.$

Technical Data

8413	-	5005	5010	5020	5050	5100	5200	5500	6001	6002	6005			
8414 with		5005	5010	5020	5050	5100								
overload protection -							000 N	500 NI	1000 N	2000 N	5000 N			
Measuring range calibrated in N and kN		5 N	10 N	20 N	50 N	100 N	200 N	500 N 112.4	1000 N 225.0	2000 N 450.0	5000 N 1124.0			
from 0		1.1 lbs	2.2 lbs	4.5 lbs	11.2 lbs	22.5 lbs	45.0 lbs	lbs	lbs	1bs	lbs			
Accuracy														
Relative non-linearity*		≤ ±0.25 % F.S.												
Characteristic curve deviation*		≤ ±0.25	$\leq \pm 0.25 \% \text{ F.S.}$ $\leq \pm 0.5 \% \text{ F.S.}$											
Relative hysteresis			≤ ±0.5 % F.S.											
Temperature effect on zero output			\leq ±0.2 % F.S./10 K											
Temperature effect on nominal sensitivity			≤ ±0.2 % F.S./10 K											
Electrical value														
Sensitivity nominal		15 mV/V		1 m	V/V				2 mV/V					
Measurement direction						compression								
Standardization		-	realized	d on board	in connect	1.0 m ion cable,	1V/V (± 0.2 1.7 m from		ising or 0.3	m from ca	ble end			
Bridge resistance		500 Ω nominal (semicon- ductor strain gage)	$500~\Omega$ nominal semiconductor $350~\Omega$ nominal (foil strain gage) deviations are possible strain											
Excitation						max. 5 V	DC or AC							
Insulation resistance						> 30 MΩ	2 at 45 V							
Environmental condi	tions													
Nominal temperature range						+15 °C	+70 °C							
Operating temperature range						-55 °C	+120 °C							
Mechanical values														
Deflection full scale		13 µm 38 µm				25	μm 50	μm						
Maximum operating force					Mode	el 8413: 1 <i>5</i>	50 % of cap	oacity						
Maximum static over- load stop					Mode	el 8414: 50	00 % of cap	oacity						
Overload burst					Mode	8413: > 2		apacity						
Dynamic performance					max	recommentimum: 100	ded: 70 % % (of capo	acity)						
Protection class		IP54												
Other		5005 5010 5020 5050 5100 5200 5500 6								6002	6005			
Material						stainless ste								
Natural frequency	[kHz]	4	4	6	12	15	15	16	20	13	15			
Mass without cable model 8413	[g]	1.2		1	.5		2.0	3.0	3.0	10.0	10.0			
Mass without cable model 8414	[g]	3.8		4	.0		-	-	-	-	-			

^{*} The data in the area 20 % - 100 % of rated load F

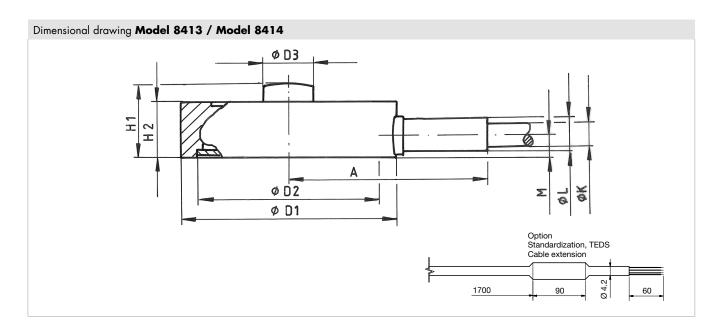

8413	-	5005	5010	5020	5050	5100	5200	5500	6001	6002	6005
Measuring range from 0		5 N	10 N	20 N	50 N	100 N	200 N	500 N	1000 N	2000 N	5000 N
Geometry											
Ø D1	[mm]			9.	.7		12	2.2	19.1		
Ø D2	[mm]	_*			8.3		10	0.0	16.0		
Ø D3	[mm]	2.3			2.2		3	.0	6.4		
H 1	[mm]	3.3			3.4			3	.8	6	.4
H 2	[mm]			2	.6		3	.3	5.7		
Α	[mm]	11.0**			9.0			10).5	13.7	
М	[mm]	1.2				1.0	1.5			.5	
ØL	[mm]	-					1.6				
ØK	[mm]	1.2					1.0				

8414 with overload protection	-	5005	5010	5020	5050	5100		
Measuring range from 0		5 N	10 N	20 N	50 N	100 N		
Geometrie								
Ø D1	[mm]	9.4		9	.7			
Ø D2	[mm]	_*		7	.0			
Ø D3	[mm]	2.3	2.2					
H 1	[mm]			6.4				
H 2	[mm]	5.8		5	.6			
Α	[mm]	11.0**		9	.0			
M	[mm]	4.2		4	.0			
ØL	[mm]	-		1	.6			
ØK	[mm]	1.2		1	.0			
General tolerance of dimension				ISO 2768f				


^{*} Measuring range 0 ... 5 N $\,$ with circular contact surfaces on the bottom with Ø 8,5 $\,$ mm $\,$

 $[\]ensuremath{^{\star\,\star}}$ Cable at this length rigid but without a slave

Electrical termination

Output signal

burster load cells are based on a strain-gage Wheatstone bridge. This measurement principle means that the output voltage mV/V is highly dependent on the sensor supply voltage. Our website contains details of suitable instrumentation amplifiers, indicator and display devices and process instruments.

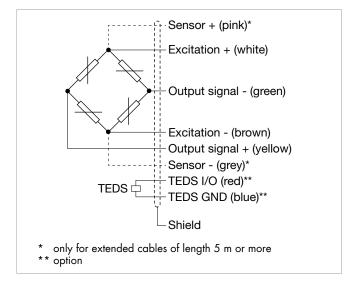

8413	-	5005	5010	5020	5050	5100	5200	5500	6001	6002	6005	
Measuring range from 0		5 N	10 N	20 N	50 N	100 N	200 N	500 N	1000 N	2000 N	5000 N	
Electrical termination												
Specifications		5 N: highly flexible teflon isolated with open ends for soldering, cable length 1.5 m ≥ 10 N: shielded, highly flexible, teflon-insulated cable, cable length 1.7 m, drag chain qualified										
Cable fastening												
Bending protection		≥ 10 N: shielded, highly flexible, teflon-insulated cable, cable length 1.7 m, drag chain qualified 5 N: epoxide resin; shed ≥ 10 N: cable cover; crimped without										
Bending radius	static: ≥ 10 mm dynamic ≥ 15 mm											

Accessories

Connectors and units

Order code

Connectors	
9941	Connectors 12 pin, suitable to all burster desktop units
9900-V209	Connectors 9 pin, suitable to SENSORMASTER, DIGIFORCE® and TRANS CAL
9900-V229	Connectors 9 pin with TEDS
9900-V245	Connectors 8 pin, suitable to ForceMaster
Units	
7281-V0001	Mobile measuring device with strain gage simulator and sensor test (R _i , R _a , Shunt, R _{ISO})
refer to section 9	Sensor electronics, amplifier and process control units like digital indicator model 9180, model 9163, modular amplifier model 9250 or DIGIFORCE® model 9307

Calibration

Test and calibration certificate									
Included in scope of delivery of sensor	Amongst other data, includes figures for zero point, full-scale output and calibration offset								
Standard factory calibration certificate for load cells or measurement chains (WKS)									
Optionally available	Our standard factory calibration certificate includes 11 measurement points, starting at zero, spread evenly in 20% steps over the full measuring range, for increasing and decreasing load under the same installation conditions.								
Special factory calib	ation certificate for load cells or measurement chains (WKS)								
On request	We are happy to calibrate sensors and measurement chains to the customer's specification.								
German-accredited [AkkS calibration certificate for sensors and measurement chains (DKD)								
Optionally available	Our DAkkS-certified calibration laboratory provides calibration certificates to DIN EN ISO 376. The calibration certificate includes 21 measurement points, starting at zero, spread evenly in 10% steps over the measuring range, for increasing and decreasing load under various installation conditions. DAkkS calibrations can be performed in the compression and/or tension direction depending on the sensor type.								



Order Code

Measuring range						Co	ode		Meas	uring I	range						
	0		5 N		5	0	0	5	0		1 lbs						
	0	10 N 5 0 1 0 0 2.2 lbs															
	0	. 20	N		5	0	2	0	0	4	5 lbs						
	0	. 50) N		5	0	5	0	0 11.2 lbs								
	0	. 100) N		5	1	0	0	0	22.	5 lbs						
	0	. 200) N		5	2	0	0	0	45.0	O Ibs						
		. 500			5	5	0	0		0 112.4 lbs							
		. 1000			6	0	0	1		225.0							
		. 2000			6	0	0	2		450.0		_					
	0	. 5000) N		6	0	0	5	0	1124.0	O Ibs	_					
									Ι.								
												Delivery	ex stoc	k at sho	rt notice)	
												,					
										Ν	0	0	0	S	0	0	0
8	4	1	3	-					-				0	S	0	0	
Nomine	al sen	sitivity/	not star	ndardize	d					Ν							
Standa										С							
			,														
Connect	ction (cable 1	.7 m (w	rith stand	lardizati	ion in th	e cable	2 m)			0						
■ Connec											F						
Connection	ction (cable 5									G						
Connect	ction (cable 3	m, exte	ended by	/ a circu	it board	d at 1,7				L						
Connect	ction (cable 5	m exte	nded *							М						
* shortened	delivery	time cor	mpared wi	ith cable ler	ngth 3 m c	ınd 5 m in	one piece										
												•					
Open of												0					
9 pins												В					
	9 pins Sub-D connector model 9900-V209 for 9163-V3xxxx											E					
	■ 12 pins round connector model 9941 for burster desktop devices											F					
9 pins	Sub-D) conne	ctor wit	h burster	· TEDS n	nodel 9	900-V2	29				T					
■ Non-lin			-	•										S			
* The data in	the ar	ea 20 % -	- 100 % of	rated load	l F												
- Nami	سما اس		ro reve	15°C	` .70	°C											
				e +15 °C				- FF °C	120-6								0
■ Extended	ea no	minal t	empera	ture ranç	ge for m	easurin	g range:	s - 33 C	120								В

Note

Brochure

Our brochure "Load cells for production, automation, R&D and quality assurance" is available for download on our website. It conatains numerous applications, detailed product specifications and overviews.

Product videos

Watch our How-to-do video at: www.youtube.com/bursterVideo





Download via www.burster.com or directly at www.traceparts.com

